可靠性试验

Reliability Test Items And Conditions

Continuous Operation Test	IF=150mA Ta=25 × 1000hrs
	IF=150mA Tj=140 × 1000hrs
Low Temperature Storage Test	-40 × 1000 hours
High Temperature Storage Test	100 × 1000 hours
Moisture-proof Test	85 , 85 %RH for 500 hours
Thermal Shock Test	-40 × 30 minutes-----100 × 30 minutes, 100 cycle

* U S .

* U defines the upper limit of the specified characteristics. S defines the initial value.

* 2 24 .

* Measurement shall be taken between 2 hours and 24 hours, and the test pieces should be return to the normal ambient conditions after the completion of each test.

包装（1）

Packaging (1)

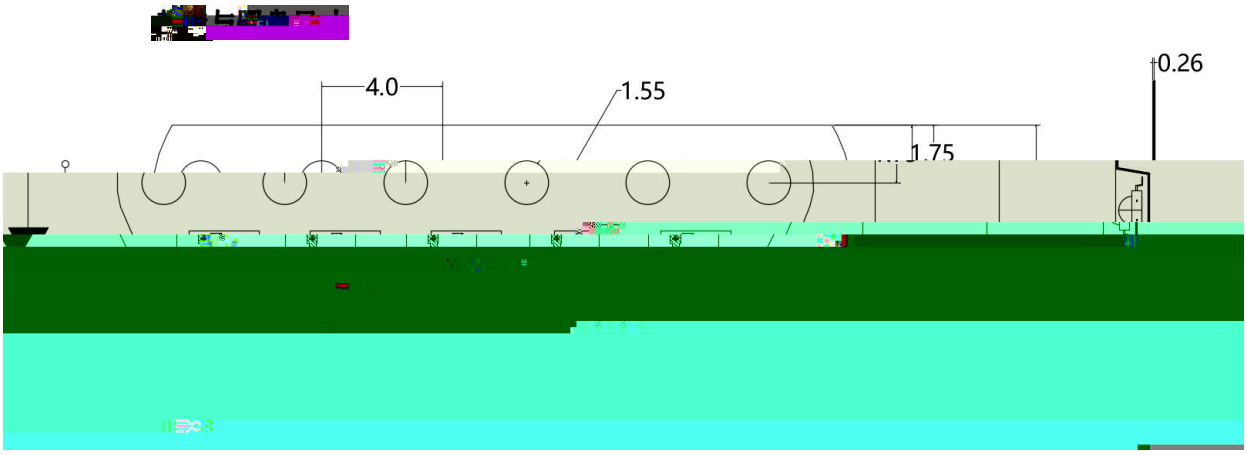

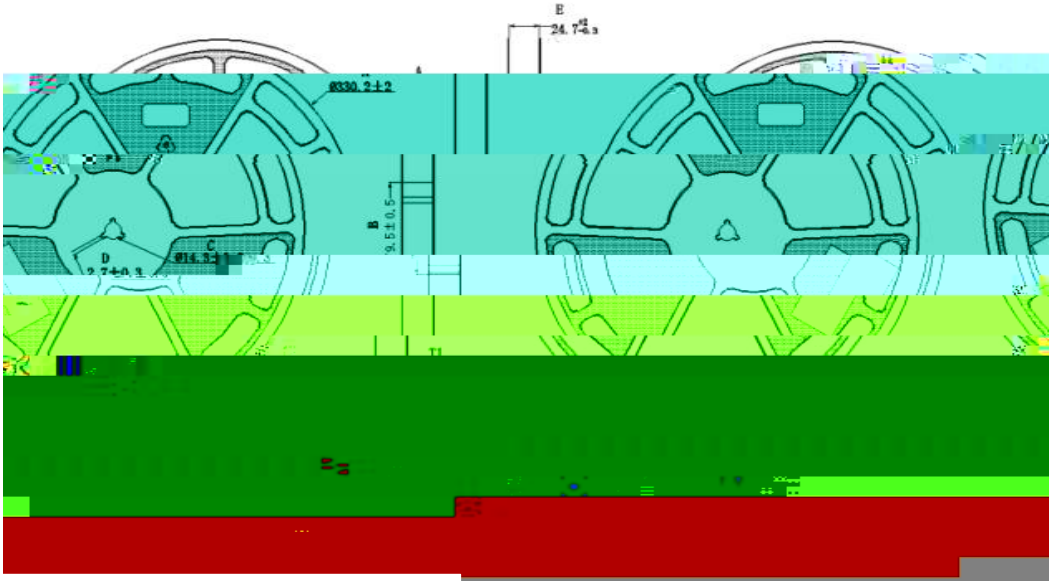

:

1. (mm)

1. Size unit is mm (mm).

2. ±0.1mm

2. The dimensional tolerance is ± 0.1mm.

圆盘及载带卷出方向及空穴规格 Disk and carrier belt direction of roll and hole dimensions

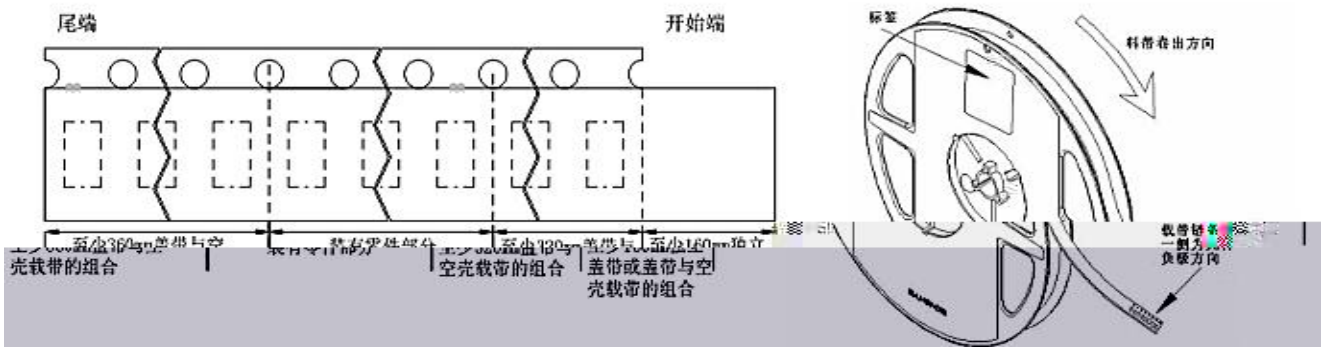

包装（2）

Packaging (2)

◇ 防潮抗静电包装 Moisture Proof and Anti-Electrostic Foil Bag

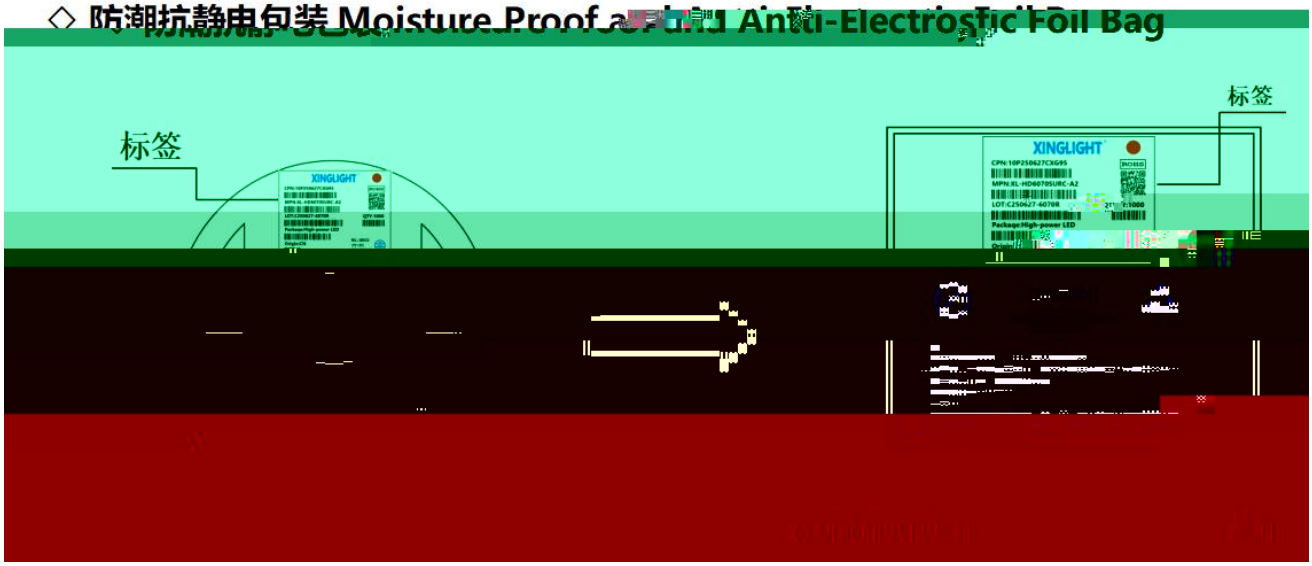

◇ 外包装箱 Cardboard Box

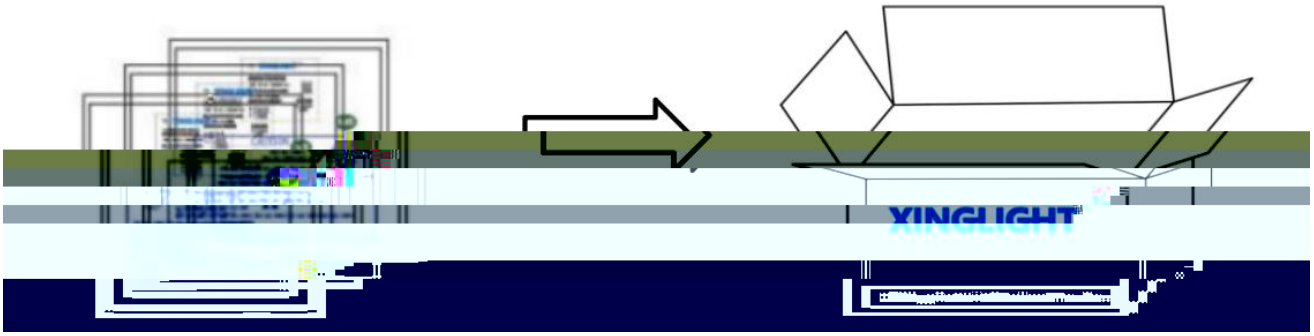

◇ 标签说明 Label Expantion

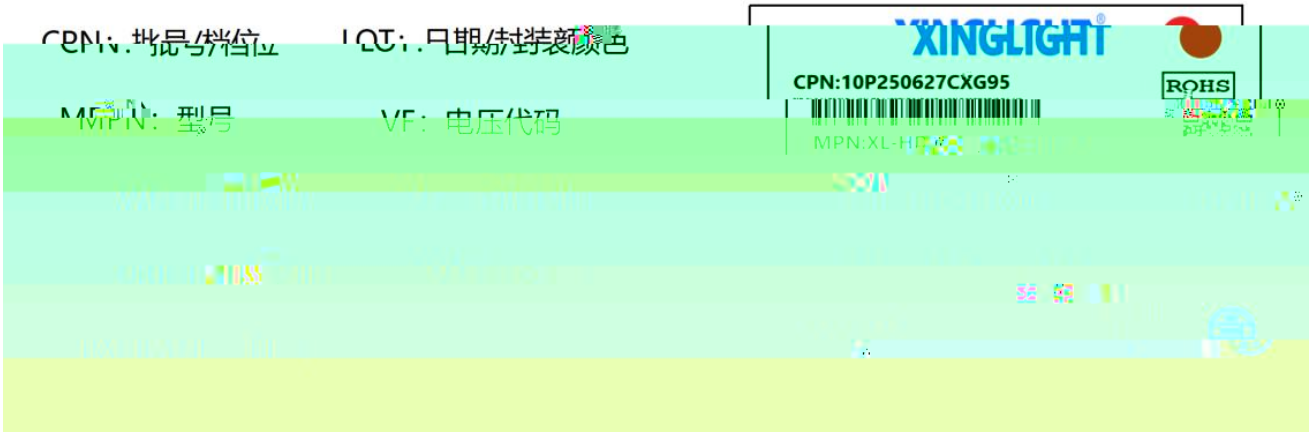

XINGLIGHT®

Part No. :XL-HD6070URC