



目录

Catalogue

电性参数
Electrical Characteristics.....3

典型特性
Typical Characteristic Curves.....5

可靠性实验
Reliability Test Items And Conditions.....6

外形尺寸
Outline Dimensions.....7

包装
Packaging.....8




焊接指导
Guideline for Soldering.....10

使用注意事项
Precautions.....12



典型特性曲线

Typical Characteristics Curves

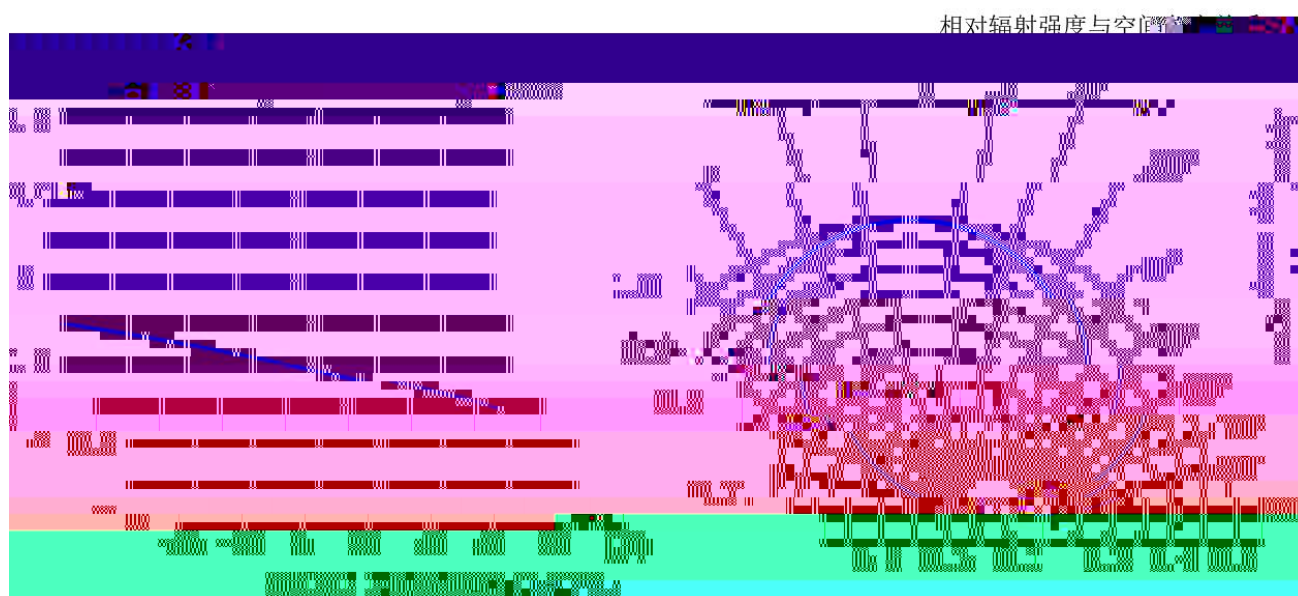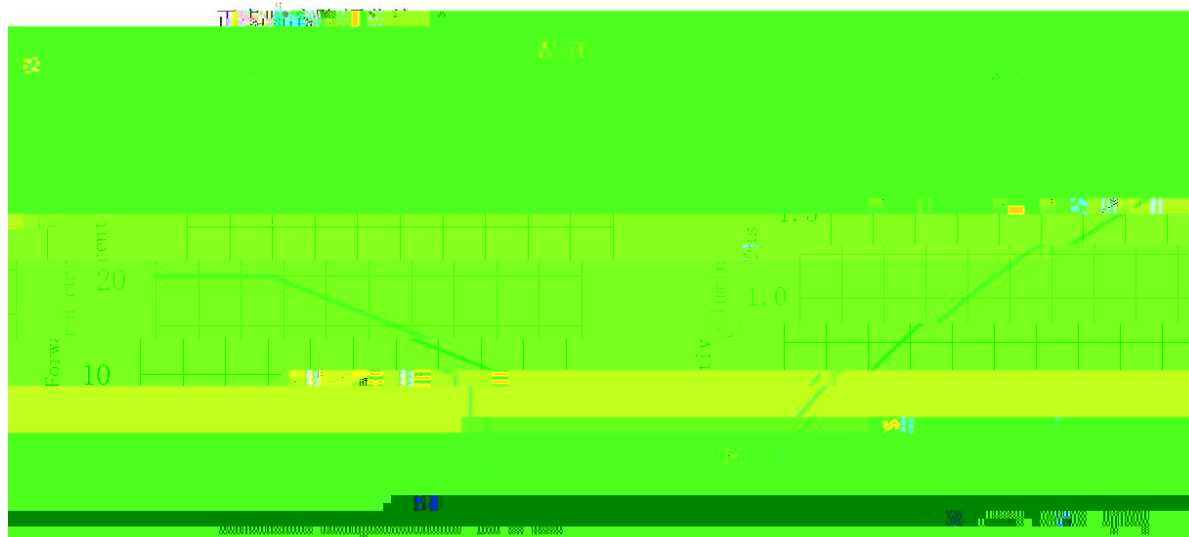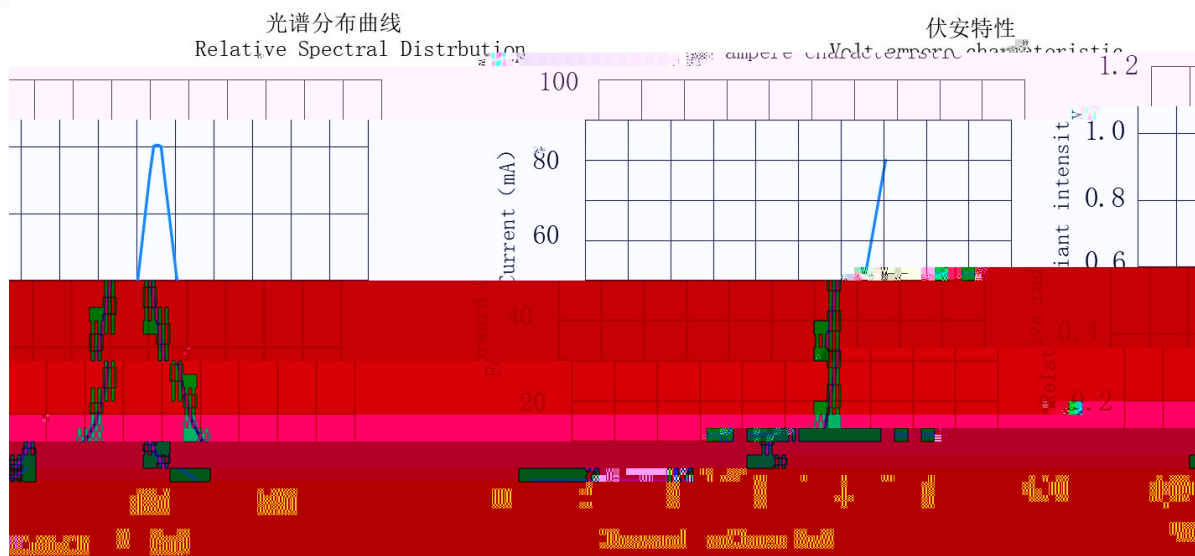

25 ± 5 °C /Note If not otherwise indicated the test environment temperature is 25 ± 5 °C

可靠性试验


Reliability Test Items And Conditions

* Reliability Test Project

Description	Item	Test criterion	Test condition	Test time	Qty
-------------	------	----------------	----------------	-----------	-----

外形尺寸

Outline Dimension

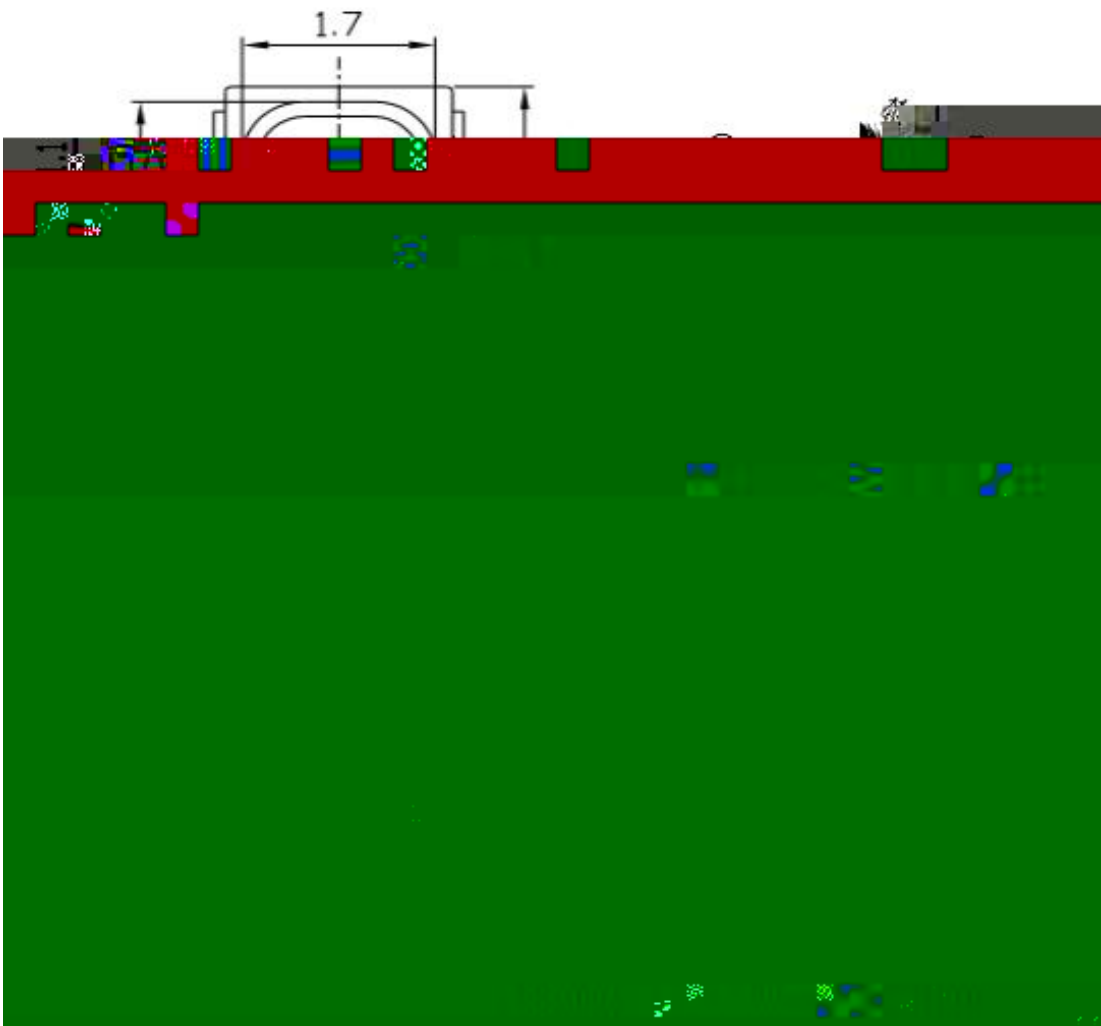

1. mm
- Remarks: All dimensions are in millimeters.
2. $\pm 0.25\text{mm}$
- Tolerance is $\pm 0.25\text{mm}$ unless otherwise noted





焊接指导 (1)

Guideline for Soldering

1. 使用烙铁入手焊接

Hand Soldering

30 W

300

3

LED

Manual welding is recommended only for repair and heavy industry situations. A soldering iron of less than 30W is recommended to be used in Hand Soldering. Please keep the temperature of the soldering iron under 300 while soldering. Each terminal of the LED is to go for less than 3 second and for one time only. Be careful because the damage of the product is often swayed at the time of the Hand





