



目录

电性参数

典型特性曲线

可靠性实验

外形尺寸

包装

焊接指南

版图注意项





亮度分档

代码	最小值	最大值	单位	测试条件
D1	50	80	mcd	IF=20mA
D2	80	120		
D9	300	350		
E1	350	400		
E2	400	450		
E3	450	500		
E4	500	600		
E5	600	700		

电压分档



代码	最小值
----	-----

波长分档

代码	最小值	最大值	单位	测试条件
HR02	620	625	nm	IF=20mA
HR03	625	630		
HB05	465	470		
HB06	470	475		
HG03	520	525		
HG04	525	530		

典型特性曲线

Typical Characteristics Curves

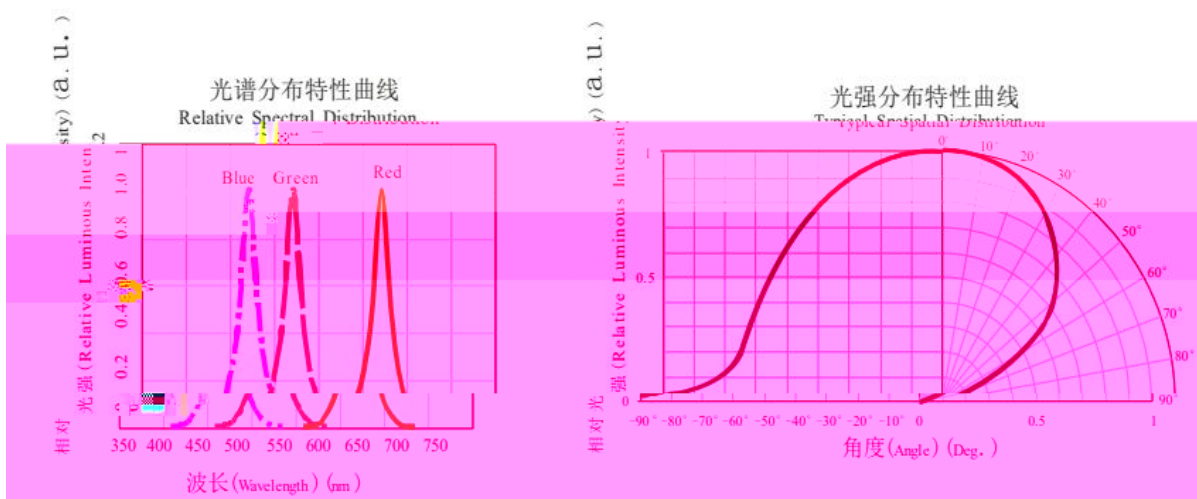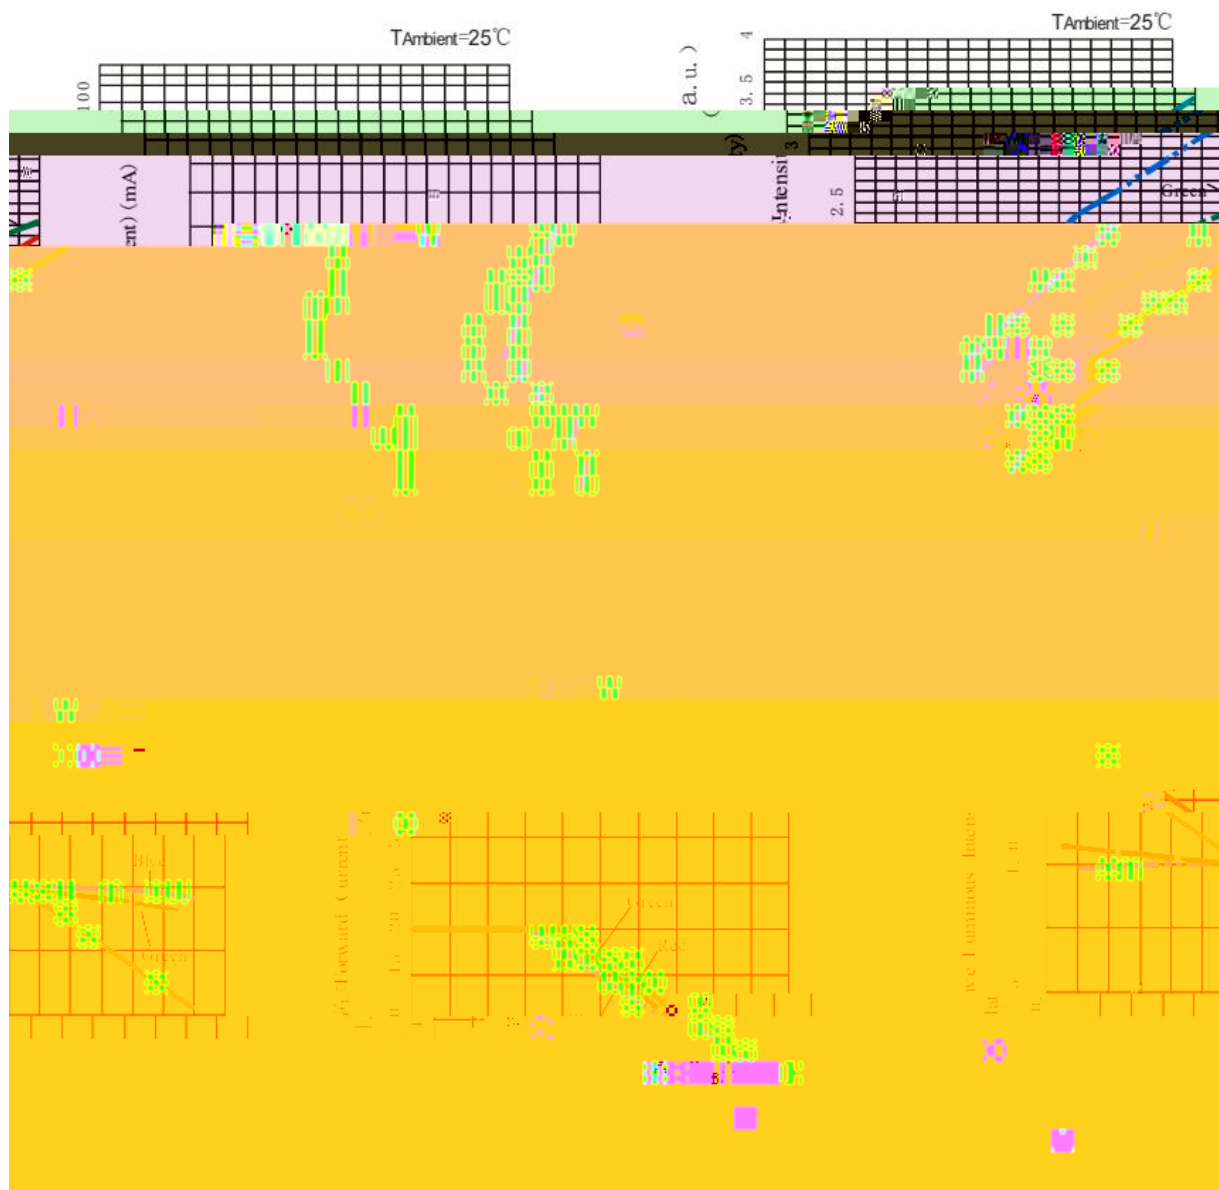






Packaging (1)

Technical drawing of a mechanical part. The drawing includes a top view and a cross-section view. The top view shows a rectangular part with three circular holes. The distance between the centers of the first two holes is 4.00. The distance from the center of the third hole to the right edge is 2.00 ± 0.05 . The distance from the center of the third hole to the bottom edge is 1.75 ± 0.05 . The total width of the part is 30 ± 0.20 . The cross-section view shows the internal structure of the part, including a central hole and a flange.


$$\vdots$$


1. (mm)
1. Size unit is mm (mm).
2. $\pm 0.1\text{mm}$
2. The dimensional tolerance is $\pm 0.1\text{mm}$.

◆ 圖 4 盤及載帶卷出方向及空穴規格 Disk and carrier belt direction of roll and hole dimensions

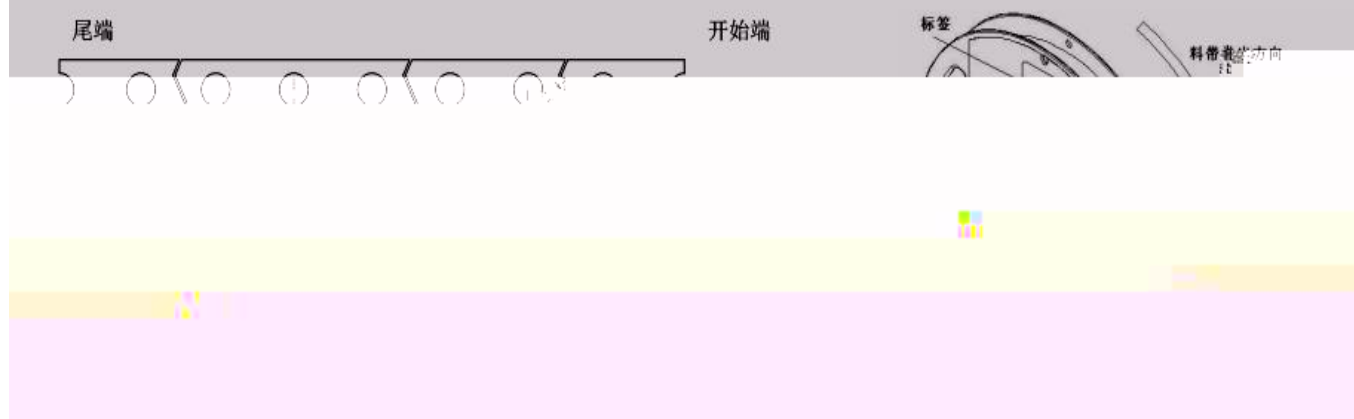



No.: XL-B1515RCBA-4E

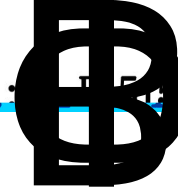

使用注意事项 (

Precautions (1)

贮存:

Moisture proof and anti-electrostatic package with moisture absorbent material is used, to keep moisture to a minimum.

30 60%RH

Before opening the package, the product should be kept at 30 or less and humidity less than 60% RH, and be used within a year. 6

30 10%RH 168 7

30 60%RH

After opening the package, the product should be stored at 30 or less and humidity less than 60% RH, and be soldered within 168 hours (7 days). It is recommended that

12 16

15 6

8

10 6

12 16 15 6 8 10 6



